NEW!

RoHS COMPLIANT

Hexa-Path Magnetics

HP1, HPH1   HP2, HPH2   HP3, HPH3   HP4, HPH4   HP5, HPH5   HP6, HPH6
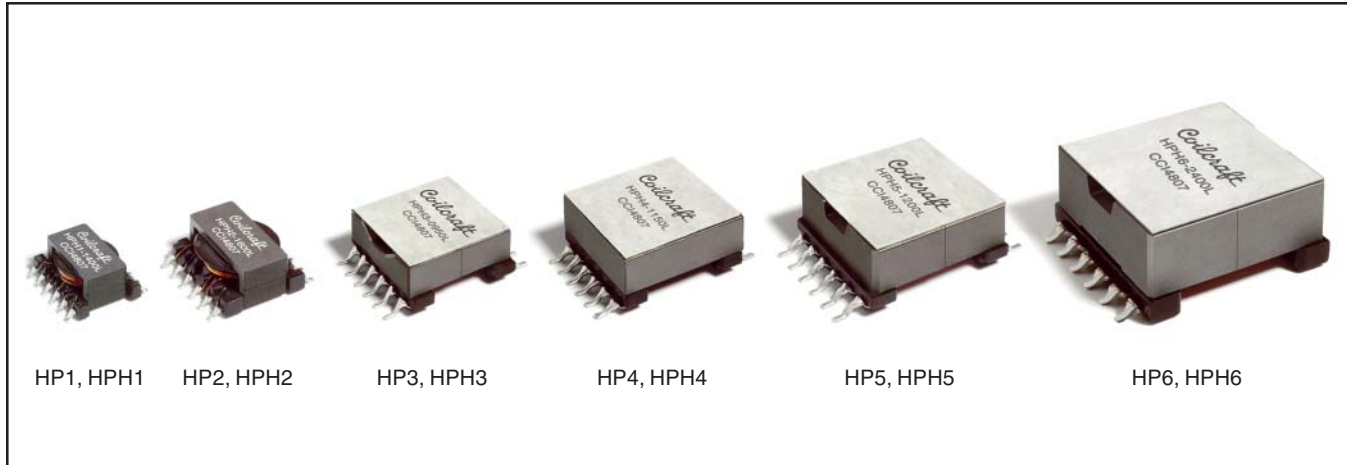
- Six 1**:**1 isolated windings that can be connected in series or parallel
- Tightly coupled windings
- Power range: 5 – 50 Watts as inductor and flyback transformer; up to 150 Watts as forward transformer
- Frequency range up to 1 MHz
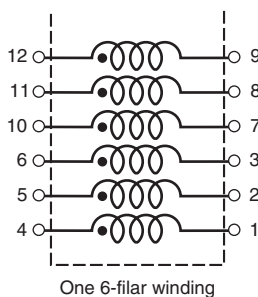- 500 Vrms Interwinding isolation

These off-the shelf parts can be used to create thousands of configurations, providing a convenient method for designers to create custom magnetics. By connecting the windings in series or parallel, the Hexa-Path components can be configured as inductors, coupled inductors and transformers for use in virtually any application: flyback, buck/boost, push-pull, forward, full and half bridge, Cuk, and SEPIC.
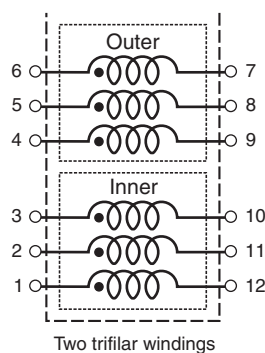
There are six different sizes available with five HP parts and five HPH parts in each size. The HP offers lower DCR and higher Irms ratings. The HPH offers higher inductance and greater energy storage capabilities.
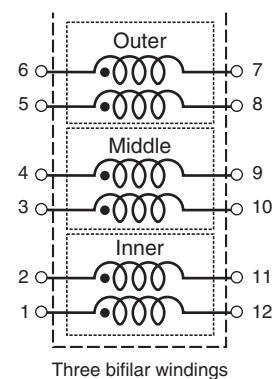
Winding Layout

HP1, HP2, HPH1, HPH2

One 6-filar winding

HP3, HP4, HP5, HP6

Two trifilar windings

HPH3, HPH4, HPH5, HPH6

Three bifilar windings

Coilcraft®

NEW!

RoHS COMPLIANT

Hexa-Path Magnetics

Part number[1]	Inductance[2] (µH)		DCR max[3] (Ohms)	Volt-time product[4] (V-µsec)	Peak energy storage[5] (µJ)	Isat[6] (A)	Irms[7] (A)
HP1-1400L_	89.6	±25%	0.130	23.4	Note 8	Note 8	0.74
HP1-0190L_	12.2	±20%	0.130	23.4	29.8	0.440	0.74
HP1-0102L_	6.5	±15%	0.130	23.4	55.1	0.820	0.74
HP1-0076L_	4.9	±10%	0.130	23.4	74.7	1.10	0.74
HP1-0059L_	3.8	±5%	0.130	23.4	93.8	1.40	0.74
HP2-1600L_	78.4	±25%	0.085	44.0	Note 8	Note 8	1.13
HP2-0216L_	10.6	±20%	0.085	44.0	79.2	0.770	1.13
HP2-0116L_	5.7	±15%	0.085	44.0	184	1.60	1.13
HP2-0083L_	4.1	±10%	0.085	44.0	228	2.10	1.13
HP2-0066L_	3.2	±5%	0.085	44.0	252	2.50	1.13
HP3-0950L_	77.0	±25%	0.055	30.4	Note 8	Note 8	1.73
HP3-0138L_	11.2	±20%	0.055	30.4	59.6	0.650	1.73
HP3-0084L_	6.8	±15%	0.055	30.4	111	1.14	1.73
HP3-0055L_	4.5	±10%	0.055	30.4	156	1.66	1.73
HP3-0047L_	3.8	±5%	0.055	30.4	173	1.90	1.73
HP4-1150L_	93.2	±25%	0.055	47.3	Note 8	Note 8	1.88
HP4-0140L_	11.3	±20%	0.055	47.3	142	1.00	1.88
HP4-0075L_	6.1	±15%	0.055	47.3	307	2.00	1.88
HP4-0060L_	4.9	±10%	0.055	47.3	386	2.50	1.88
HP4-0047L_	3.8	±5%	0.055	47.3	490	3.20	1.88
HP5-1200L_	76.8	±25%	0.045	62.8	Note 8	Note 8	2.25
HP5-0155L_	9.9	±20%	0.045	62.8	281	1.50	2.25
HP5-0083L_	5.3	±15%	0.045	62.8	562	2.90	2.25
HP5-0067L_	4.3	±10%	0.045	62.8	626	3.40	2.25
HP5-0053L_	3.4	±5%	0.045	62.8	946	4.70	2.25
HP6-2400L_	86.4	±25%	0.020	87.9	Note 8	Note 8	3.50
HP6-0325L_	11.7	±20%	0.020	87.9	332	1.50	3.50
HP6-0158L_	5.69	±15%	0.020	87.9	981	3.70	3.50
HP6-0121L_	4.36	±10%	0.020	87.9	1485	5.20	3.50
HP6-0090L_	3.24	±5%	0.020	87.9	1833	6.70	3.50
HPH1-1400L_	202	±25%	0.340	35.1	Note 8	Note 8	0.62
HPH1-0190L_	27.4	±20%	0.340	35.1	31.1	0.300	0.62
HPH1-0102L_	14.7	±15%	0.340	35.1	60.2	0.570	0.62
HPH1-0076L_	10.9	±10%	0.340	35.1	99.2	0.850	0.62
HPH1-0059L_	8.5	±5%	0.340	35.1	107	1.00	0.62
HPH2-1600L_	160	±25%	0.155	30.8	Note 8	Note 8	0.83
HPH2-0216L_	21.6	±20%	0.155	30.8	82.3	0.550	0.83
HPH2-0116L_	11.6	±15%	0.155	30.8	177	1.10	0.83
HPH2-0083L_	8.3	±10%	0.155	30.8	302	1.70	0.83
HPH2-0066L_	6.6	±5%	0.155	30.8	333	2.00	0.83
HPH3-0950L_	160	±25%	0.125	43.9	Note 8	Note 8	1.13
HPH3-0138L_	23.6	±20%	0.125	43.9	52.5	0.420	1.13
HPH3-0084L_	14.2	±15%	0.125	43.9	98.0	0.740	1.13
HPH3-0055L_	9.3	±10%	0.125	43.9	169	1.20	1.13
HPH3-0047L_	7.94	±5%	0.125	43.9	196	1.40	1.13
HPH4-1150L_	194	±25%	0.078	68.3	Note 8	Note 8	1.65
HPH4-0140L_	23.7	±20%	0.078	68.3	138	0.680	1.65
HPH4-0075L_	12.7	±15%	0.078	68.3	314	1.40	1.65
HPH4-0060L_	10.1	±10%	0.078	68.3	368	1.70	1.65
HPH4-0047L_	7.94	±5%	0.078	68.3	529	2.30	1.65
HPH5-1200L_	173	±25%	0.070	94.2	Note 8	Note 8	1.95
HPH5-0155L_	22.3	±20%	0.070	94.2	248	0.940	1.95
HPH5-0083L_	12.0	±15%	0.070	94.2	546	1.90	1.95
HPH5-0067L_	9.65	±10%	0.070	94.2	700	2.40	1.95
HPH5-0053L_	7.63	±5%	0.070	94.2	809	2.90	1.95
HPH6-2400L_	194	±25%	0.030	131.9	Note 8	Note 8	2.90
HPH6-0325L_	26.3	±20%	0.030	131.9	477	1.20	2.90
HPH6-0158L_	12.8	±15%	0.030	131.9	1176	2.70	2.90
HPH6-0121L_	9.8	±10%	0.030	131.9	1783	3.80	2.90
HPH6-0090L_	7.29	±5%	0.030	131.9	1944	4.60	2.90

1. Please specify **termination** and **packaging** codes:

HPH1-1400 L D

Termination: L = RoHS compliant tin-silver over tin over nickel over phos bronze. Special order:
T = RoHS tin-silver-copper (95.5/4/0.5) or
S = non-RoHS tin-lead (63/37).

Packaging: D = 13″ machine-ready reel. EIA-481 embossed plastic tape

B = Less than full reel. In tape, but not machine ready. To have a leader and trailer added ($25 charge), use code letter D instead.

2. Inductance is per winding, measured at 100 kHz, 0.1 Vrms, 0 Adc.
3. DCR is per winding, measured on Cambridge Technology micro-ohmmeter or equivalent.
4. Volt-time product is for a single winding or multiple windings connected in parallel. To calculate volt-time product for windings connected in series, multiply the value specified in the table by the number of windings connected in series.
5. Peak energy storage is for any combination of windings, assuming saturation current applied. See note 6 for definition of saturation current.
6. DC current at which the inductance drops 30% typ from its value without current, based on current applied to all six windings connected in series. For applications where all windings are not connected in series, use the following equation to calculate Isat:
$\text{Isat} = \text{Isat}_{table} \times 6 \div$ number of windings in series.
7. Current that causes a 40°C rise from 25°C ambient due to self heating, tested with continuous current flow through all windings connected in series. Application temperature rise will depend on the operating current, duty cycle, and winding connection.
8. Part is designed exclusively for use as a forward converter transformer and was not tested for energy storage and saturation current.
9. Electrical specifications at 25°C.

Core material Ferrite

Terminations RoHS tin-silver over tin over nickel over phos bronze. Other terminations available at additional cost.

Ambient temperature –40°C to +85°C with Irms current, +85°C to +125°C with derated current

Storage temperature Component: –40°C to +125°C. Packaging: –55°C to +80°C

Resistance to soldering heat Max three 40 second reflows at +260°C, parts cooled to room temperature between cycles

Moisture Sensitivity Level (MSL) 1 (unlimited floor life at <30°C / 85% relative humidity)

Mean Time Between Failures (MTBF) 26,315,789 hours

PCB washing Only pure water or alcohol recommended

Coilcraft®

Specifications subject to change without notice.
Please check our website for latest information.   Document 613-2   Revised 08/14/08

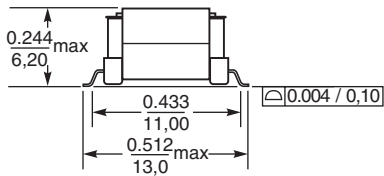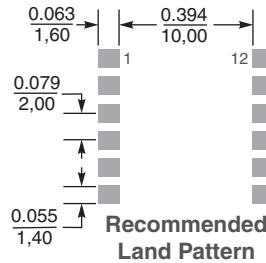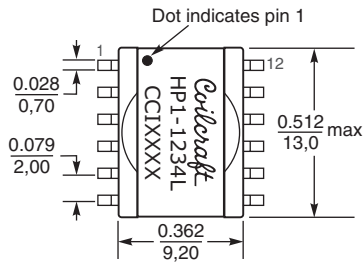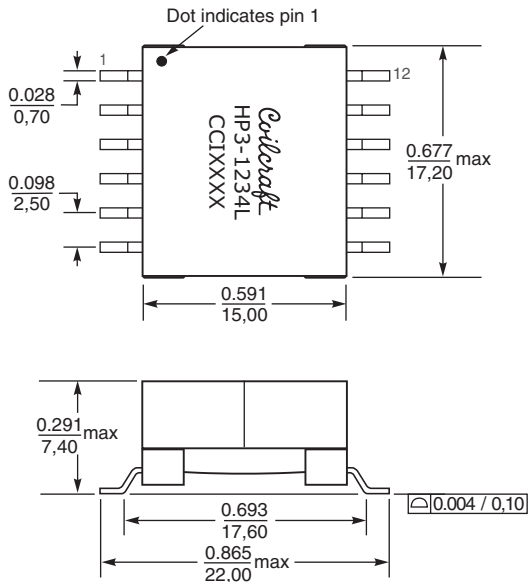1102 Silver Lake Road   Cary, Illinois 60013   **Phone** 847/639-6400   **Fax** 847/639-1469
E-mail info@coilcraft.com   **Web** http://www.coilcraft.com
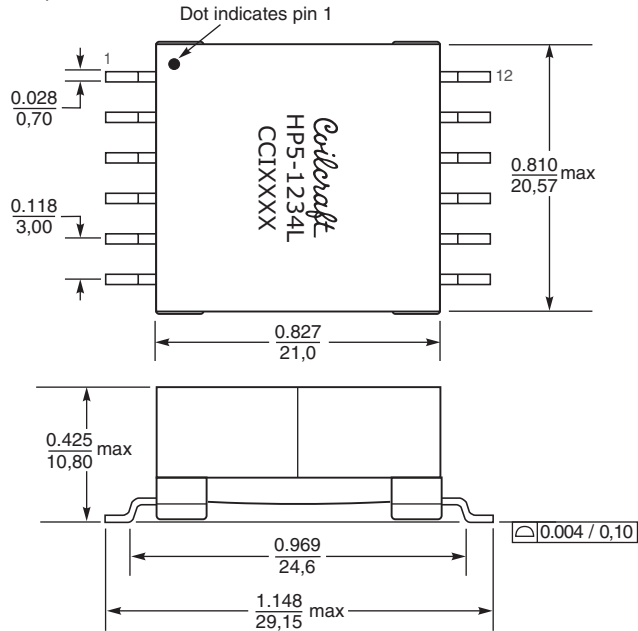
© Coilcraft, Inc. 2008

NEW!

Hexa-Path Magnetics

HP1, HPH1

Dot indicates pin 1

1

Coilcraft
HP1-1234L
CCIXXXX

12

$\frac{0.028}{0,70}$

$\frac{0.079}{2,00}$

$\frac{0.512}{13,0}$ max

$\frac{0.362}{9,20}$

$\frac{0.063}{1,60}$

$\frac{0.394}{10,00}$

1   12

$\frac{0.079}{2,00}$

$\frac{0.055}{1,40}$ **Recommended Land Pattern**

$\frac{0.244}{6,20}$ max

$\frac{0.433}{11,00}$

$\frac{0.512}{13,0}$ max

◁ 0.004 / 0,10

Dimensions are in $\frac{\text{inches}}{\text{mm}}$

Weight: 1.4 g

Packaging 500 per 13″ reel   Plastic tape: 24 mm wide, 0.35 mm thick, 16 mm pocket spacing, 6.13 mm pocket depth

HP2, HPH2

Dot indicates pin 1

1

Coilcraft
HP2-1234L
CCIXXXX

12

$\frac{0.028}{0,70}$

$\frac{0.098}{2,50}$

$\frac{0.642}{16,30}$ max

$\frac{0.508}{12,90}$

$\frac{0.098}{2,50}$

$\frac{0.512}{13,00}$

$\frac{0.079}{2,50}$

1   12

Recommended Land Pattern

$\frac{0.069}{1,75}$

$\frac{0.291}{7,40}$ max

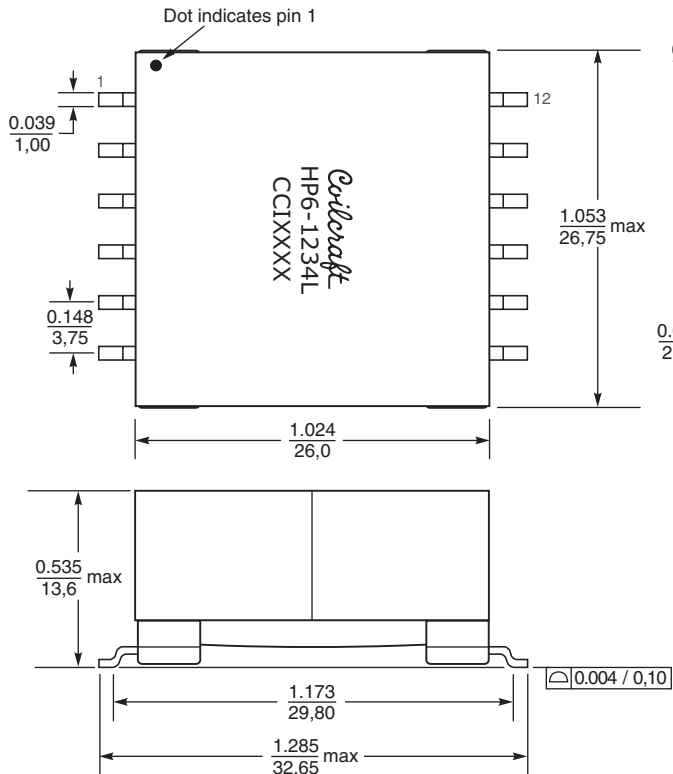$\frac{0.575}{14,60}$

$\frac{0.661}{16,80}$ max

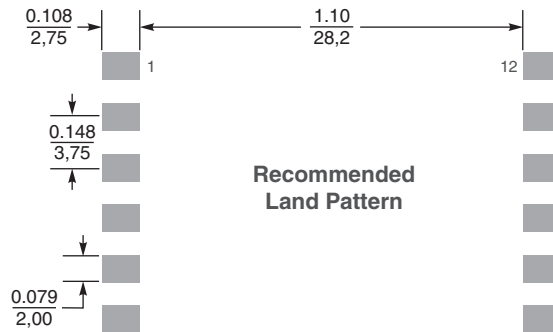◁ 0.004 / 0,10
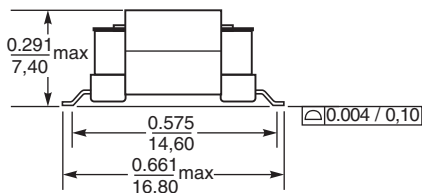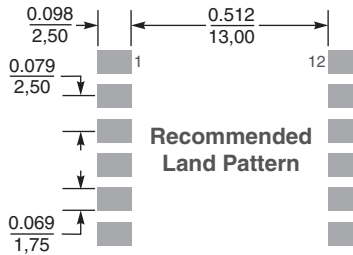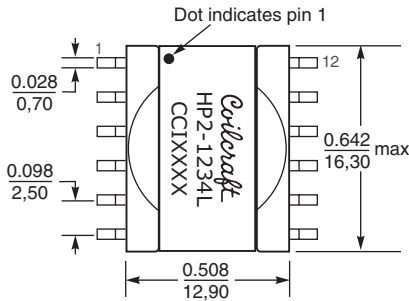
Dimensions are in $\frac{\text{inches}}{\text{mm}}$

Weight: 2.7 – 2.8 g

Packaging 400 per 13″ reel   Plastic tape: 32 mm wide, 0.4 mm thick, 20 mm pocket spacing, 7.6 mm pocket depth

Coilcraft®

NEW!

RoHS COMPLIANT

Hexa-Path Magnetics

HP3, HPH3

Dot indicates pin 1

0.028 / 0,70

0.098 / 2,50

0.677 / 17,20 max

0.591 / 15,00

0.291 / 7,40 max

0.693 / 17,60

0.865 / 22,00 max

⌴ 0.004 / 0,10

Dimensions are in inches / mm

Recommended Land Pattern

0.135 / 3,43

0.665 / 16,88

0.098 / 2,50

0.069 / 1,75
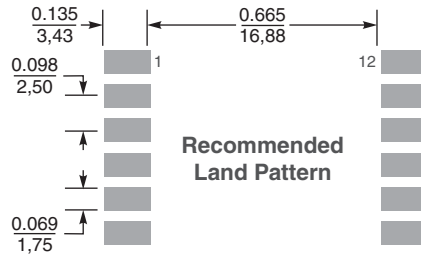
Weight: 4.2 – 4.6 g

Packaging 200 per 13″ reel   Plastic tape: 44 mm wide, 0.4 mm thick, 28 mm pocket spacing, 9.6 mm pocket depth

HP4, HPH4

Dot indicates pin 1

0.028 / 0,70

0.100 / 2,54

0.685 / 17,40 max

0.699 / 17,00

0.382 / 9,70 max

0.799 / 20.30

0.950 / 24,13 max

⌴ 0.004 / 0,10

Dimensions are in inches / mm

Recommended Land Pattern

0.130 / 3,30

0.748 / 19,0

0.100 / 2,54

0.069 / 1,75
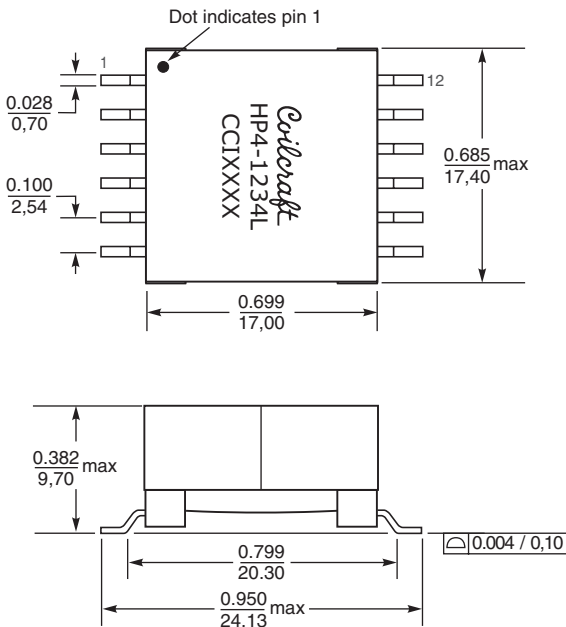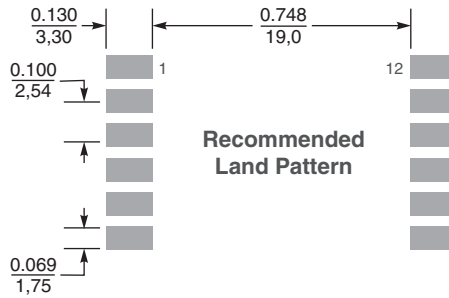
Weight: 6.8 – 7.5 g

Packaging 200 per 13″ reel   Plastic tape: 44 mm wide, 0.4 mm thick, 24 mm pocket spacing, 11.5 mm pocket depth

Coilcraft®

Specifications subject to change without notice.
Please check our website for latest information.

Document 613-4   Revised 08/14/08

1102 Silver Lake Road   Cary, Illinois 60013   **Phone** 847/639-6400   **Fax** 847/639-1469
E-mail info@coilcraft.com   **Web** http://www.coilcraft.com

© Coilcraft, Inc. 2008

NEW!

Hexa-Path Magnetics

RoHS COMPLIANT

HP5, HPH5

Dot indicates pin 1

1

$\frac{0.028}{0,70}$

$\frac{0.118}{3,00}$

Coilcraft
HP5-1234L
CCIXXXX

12

$\frac{0.810}{20,57}$ max

$\frac{0.827}{21,0}$

$\frac{0.425}{10,80}$ max

$\frac{0.969}{24,6}$

$\frac{1.148}{29,15}$ max

0.004 / 0,10

Dimensions are in $\frac{inches}{mm}$

$\frac{0.130}{3,3}$

$\frac{0.930}{23,62}$

$\frac{0.118}{3,00}$

1

Recommended Land Pattern

12

$\frac{0.069}{1,75}$
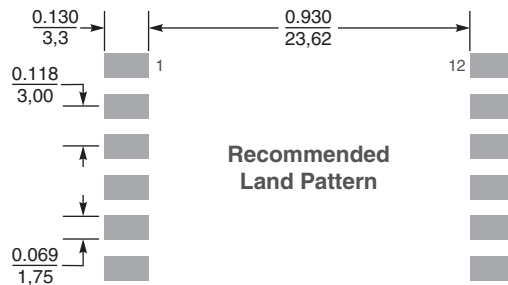
Weight: 10.6 – 11.5 g

Packaging 175 per 13″ reel   Plastic tape: 44 mm wide, 0.4 mm thick, 28 mm pocket spacing, 12.0 mm pocket depth

HP6, HPH6

Dot indicates pin 1

1

$\frac{0.039}{1,00}$

$\frac{0.148}{3,75}$

Coilcraft
HP6-1234L
CCIXXXX

12

$\frac{1.053}{26,75}$ max

$\frac{1.024}{26,0}$

$\frac{0.535}{13,6}$ max

$\frac{1.173}{29,80}$

$\frac{1.285}{32,65}$ max

0.004 / 0,10

Dimensions are in $\frac{inches}{mm}$

$\frac{0.108}{2,75}$

$\frac{1.10}{28,2}$

$\frac{0.148}{3,75}$

1

Recommended Land Pattern

12

$\frac{0.079}{2,00}$

Weight: 22.4 – 24.3 g

Packaging 50 per 13″ reel   Plastic tape: 56 mm wide, 0.5 mm thick, 36 mm pocket spacing, 14.55 mm pocket depth

Coilcraft ®

NEW!

Hexa-Path Magnetics
Formulas used to calculate electrical characteristics

Connecting windings in series

Inductance = Inductance$_{table}$ × (number of windings)^2
DCR = DCR$_{table}$ × number of windings
Isat = (Isat$_{table}$ × 6) ÷ number of windings connected in series
Irms = Irms$_{table}$

Connecting windings in parallel

Inductance = Inductance$_{table}$
DCR = 1 ÷ [number of windings × (1 ÷ DCR$_{table}$)]
Isat = (Isat$_{table}$ × 6) ÷ number of windings connected in series
Irms = Irms$_{table}$ × number of windings

Inductors – using multiple windings

Part number	Inductance (µH)	DCR max (Ohms)	Volt-time product (V-µsec)	Peak energy storage (µJ)	Isat (A)	Irms (A)
HP3-0138L_	11.2 ±20%	0.055	30.4	1.656	0.650	1.73

Connecting windings in series

For higher inductance, the windings can be connected in series. As inductance increases, energy storage and Irms remain the same, but DCR increases and Isat decreases.

Example: Calculate new electricals for HP3-0138L with four windings (W$_n$) connected in series:

Inductance = Inductance$_{table}$ × W$_n^2$
= 11.2 × 4^2 = 179.2 µH

DCR = DCR$_{table}$ × W$_n$
= 0.055 × 4 = 0.22 Ohms

Isat = (Isat$_{table}$) × 6 ÷ W$_n$
= (0.65 × 6) ÷ 4 = 0.975 A

Irms = Irms$_{table}$
= 1.73 A
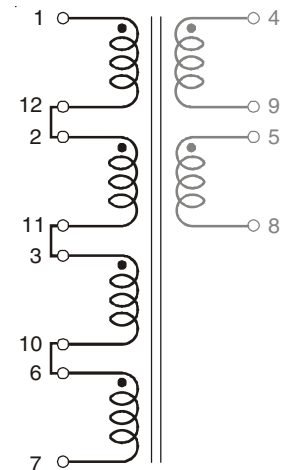
L = 179.2 µH
DCR = 0.22 Ω
Isat = 0.975 A
Irms = 1.73 A

Connecting windings in parallel

To increase current ratings, the windings (W$_n$) can be connected in parallel. DCR decreases, current ratings increase, and inductance remains the same.

Example: Calculate new electricals for HP5-0083L, with three (W$_n$) windings connected in parallel (equivalent to one winding in series):

Inductance = Inductance$_{table}$
= 11.2 µH

DCR = 1 ÷ [W$_n$ × (1 ÷ DCR$_{table}$)]
= 1 ÷ [3 × (1 ÷ 0.045)] = 0.015 Ohms

Isat = (Isat$_{table}$ × 6) ÷ W$_n$
= (0.65 × 6) ÷ 1 = 3.9 A

Irms = Irms$_{table}$ × W$_n$
= 1.73 × 3 = 5.19 A

L = 11.2 µH
DCR = 0.015 Ω
Isat = 3.9 A
Irms = 5.19 A

Coilcraft ®

NEW!

RoHS COMPLIANT

Hexa-Path Magnetics
Formulas used to calculate electrical characteristics

Connecting windings in series

Inductance $= $ Inductance$_{table} \times$ (number of windings)^2
DCR $=$ DCR$_{table} \times$ number of windings
Isat $= $ (Isat$_{table} \times 6$) $\div$ number of windings connected in series
Irms $= $ Irms$_{table}$

Connecting windings in parallel

Inductance $=$ Inductance$_{table}$
DCR $= 1 \div$ [number of windings $\times$ (1 $\div$ DCR$_{table}$)]
Isat $= $ (Isat$_{table} \times 6$) $\div$ number of windings connected in series
Irms $= $ Irms$_{table} \times$ number of windings

Create a 13 Watt 2 : 1 : 1 flyback transformer with a bias winding

Choose HPH3-0138L

Vin = 36 – 57 Vdc; Vout = 12 V, 1.1 A

Part number	Inductance (µH)	DCR max (Ohms)	Volt-time product (V-µsec)	Peak energy storage (µJ)	Isat (A)	Irms (A)
HPH3-0138L	23.6 ±20%	0.125	43.9	1.457	0.420	1.13

Connecting primary windings in series

When primary windings (W$_{pri}$) are connected in series, inductance increases, energy storage and Irms remain the same, but DCR increases and Isat decreases.

Example: For HPH3-0138L, connect two primary windings in series:

Inductance $= $ Inductance$_{table} \times$ W$_{pri}^2$
    $= 23.6 \times 2^2 = 94.4$ µH

DCR $= $ DCR$_{table} \times$ W$_{pri}$
    $= 0.125 \times 2 = 0.25$ Ohms

Isat $= $ (Isat$_{table} \times 6$) $\div$ W$_{pri}$
    $= (0.42 \times 6) \div 2 = 1.26$ A

Irms $= $ Irms$_{table}$
    $= 1.13$ A

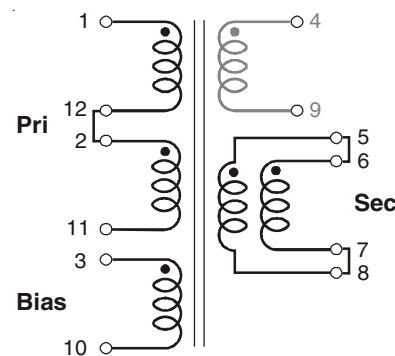### Connecting secondary windings in parallel

When secondary windings (W$_{sec}$) are connected in parallel, DCR decreases and Irms increases.

Example: For HPH3-0083L, connect two secondary windings in parallel:

DCR $= 1 \div$ [W$_{sec} \times$ (1 $\div$ DCR$_{table}$)]
    $= 1 \div$ [(2 $\times$ (1 $\div$ 0.125)] = 0.0625 Ohms

Irms $= $ Irms$_{table} \times$ W$_{sec}$
    $= 1.13 \times 2 = 2.26$ A

Pri — 1, 12, 2, 11, 3
Bias — 10
Sec — 4, 9, 5, 6, 7, 8

Primary:
L = 94.4 µH
DCR = 0.25Ω
Isat = 1.26 A
Irms = 1.13 A

Secondary:
DCR = 0.0625Ω
Irms = 2.26 A

NEW!

Hexa-Path Magnetics
Formulas used to calculate electrical characteristics

Connecting windings in series

Inductance $= $ Inductance$_{table} \times$ (number of windings)^2
DCR $=$ DCR$_{table} \times$ number of windings
Isat $=$ (Isat$_{table} \times 6$) ÷ number of windings connected in series
Irms $=$ Irms$_{table}$

Connecting windings in parallel

Inductance $=$ Inductance$_{table}$
DCR $= 1 \div$ [number of windings $\times$ (1 ÷ DCR$_{table}$)]
Isat $=$ (Isat$_{table} \times 6$) ÷ number of windings connected in series
Irms $=$ Irms$_{table} \times$ number of windings

Create a 130 Watt, 1 : 1, two switch forward converter transformer

Choose HPH6-2400L

Vin $= 36 – 57$ Vdc; Vout $= 12$ V, 10.8 A

Part number	Inductance (µH)	DCR max (Ohms)	Volt-time product (V-µsec)	Peak energy storage (µJ)	Isat (A)	Irms (A)
HPH6-2400L	194 ±25%	0.030	131.9	N/A	N/A	2.90

Connecting primary windings in parallel

When primary windings (W$_{pri}$) are connected in parallel, DCR decreases, Irms increases, and inductance and volt-time product remain the same.

Example: For HPH6-2400L, connect three primary windings in parallel:

Inductance $=$ Inductance$_{table}$
$\qquad = 194$ µH

DCR $= 1 \div$ [W$_{pri} \times$ (1 ÷ DCR$_{table}$)]
$\qquad = 1 \div$ [(3 × (1 ÷ 0.030)] $= 0.010$ Ohms

VT $=$ VT$_{table}$
$\qquad = 131.9$ V-µsec

Irms $=$ Irms$_{table} \times$ W$_{pri}$
$\qquad = 2.90 \times 3 = 8.70$ A

Primary:
L = 194 µH
DCR = 0.01Ω
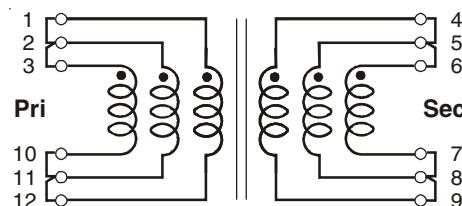Irms = 8.7 A
VT = 131.9 V-µsec

Secondary:
DCR = 0.01Ω
Irms = 8.7 A

Connecting secondary windings in parallel

When secondary windings (W$_{sec}$) are connected in parallel, DCR decreases and Irms increases.

Example: For HPH6-2400L, connect three secondary windings in parallel:

DCR $= 1 \div$ [W$_{sec} \times$ (1 ÷ DCR$_{table}$)]
$\qquad = 1 \div$ [(3 × (1 ÷ 0.030)] $= 0.010$ Ohms

Irms $=$ Irms$_{table} \times$ W$_{sec}$
$\qquad = 2.90 \times 3 = 8.70$ A

Coilcraft®

NEW!

Hexa-Path Magnetics
Formulas used to calculate electrical characteristics

Connecting windings in series

Inductance $=$ Inductance$_{table}$ $\times$ (number of windings)^2
DCR $=$ DCR$_{table}$ $\times$ number of windings
Isat $=$ (Isat$_{table}$ $\times$ 6) $\div$ number of windings connected in series
Irms $=$ Irms$_{table}$

Connecting windings in parallel

Inductance $=$ Inductance$_{table}$
DCR $=$ 1 $\div$ [number of windings $\times$ (1 $\div$ DCR$_{table}$)]
Isat $=$ (Isat$_{table}$ $\times$ 6) $\div$ number of windings connected in series
Irms $=$ Irms$_{table}$ $\times$ number of windings

Create a 100 Watt, 1 : 2, half bridge forward converter transformer with center tapped secondary

Choose HP6-2400L

Vin $=$ 36 – 57 Vdc; Vout $=$ 24 V, 4.2 A

Part number	Inductance (µH)	DCR max (Ohms)	Volt-time product (V-µsec)	Peak energy storage (µJ)	Isat (A)	Irms (A)
HPH6-2400L	194 ±25%	0.030	131.9	N/A	N/A	2.90

Connecting primary windings in parallel

When primary windings (W$_{pri}$) are connected in parallel, DCR decreases, current ratings increase, and inductance and volt-time product remain the same.

Example: For HPH-2400L, connect two primary windings in parallel:

Inductance $=$ Inductance$_{table}$
$\qquad\quad\; = 194$ µH

DCR $= 1 \div$ [W$_{pri}$ $\times$ (1 $\div$ DCR$_{table}$)]
$\qquad\; = 1 \div$ [(2 $\times$ (1 $\div$ 0.030)] $= 0.015$ Ohms

VT $=$ VT$_{table}$
$\quad\;\; = 131.9$ V-µsec

Irms $=$ Irms$_{table}$ $\times$ W$_{pri}$
$\qquad = 2.90 \times 2 = 5.8$ A

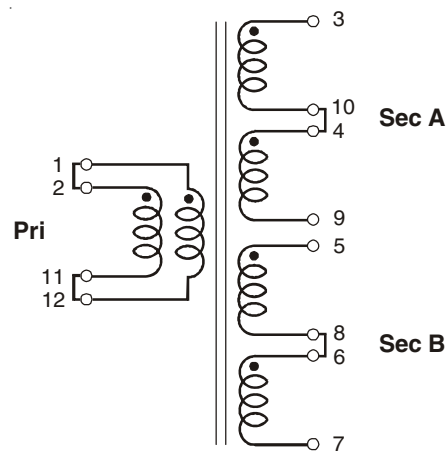### Connecting secondary windings in series

When secondary windings (W$_{sec}$) are connected in series, Irms remains the same, but DCR increases.

Example: For HP6-2400L, connect four secondary windings in series, creating a center tap at pins 9 and 5. For each half of the secondary:

DCR $=$ DCR$_{table}$ $\times$ W$_{sec}$
$\qquad = 0.030 \times 2 = 0.060$ Ohms

Irms $=$ Irms$_{table}$
$\qquad = 2.9$ A

Primary:
L $= 194$ µH
DCR $= 0.015\Omega$
Irms $= 5.8$ A
VT $= 131.9$ V-µsec

Each half secondary;
Sec A (3-9), Sec B5-7):
DCR $= 0.06\Omega$
Irms $= 2.9$ A

Coilcraft®

NEW!

RoHS COMPLIANT

Hexa-Path Magnetics
Formulas used to calculate electrical characteristics

Connecting windings in series

Inductance $=$ Inductance$_{table} \times$ (number of windings)^2
DCR $=$ DCR$_{table} \times$ number of windings
Isat $=$ (Isat$_{table} \times 6$) $\div$ number of windings connected in series
Irms $=$ Irms$_{table}$

Connecting windings in parallel

Inductance $=$ Inductance$_{table}$
DCR $= 1 \div$ [number of windings $\times$ ($1 \div$ DCR$_{table}$)]
Isat $=$ (Isat$_{table} \times 6$) $\div$ number of windings connected in series
Irms $=$ Irms$_{table} \times$ number of windings

Create a 1 : 1 gate drive transformer

Choose HP1-1400L

Part number	Inductance (µH)	DCR max (Ohms)	Volt-time product (V-µsec)	Peak energy storage (µJ)	Isat (A)	Irms (A)
HP1-1400L	89.6 ±25%	0.130	23.4	N/A	N/A	0.74

Connecting primary windings in series

When primary windings (W$_{pri}$) are connected in series, inductance and volt-time product increase, energy storage and Irms remain the same, but DCR increases.

Example: For HPH1-1400L, connect three primary windings in series:

Inductance $=$ Inductance$_{table} \times$ W$_{pri}^2$
$\qquad = 89.6 \times 3^2 = 806.4$ µH

DCR $=$ DCR$_{table} \times$ W$_{pri}$
$\qquad = 0.130 \times 3 = 0.39$ Ohms

VT $=$ VT$_{table} \times$ W$_{pri}$
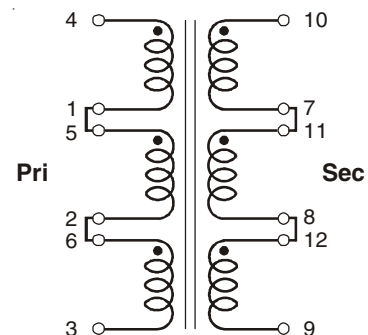$\qquad = 70.2$ V-µsec

Irms $=$ Irms$_{table}$
$\qquad = 0.74$

Connecting secondary windings in series

When secondary windings (W$_{sec}$) are connected in series, Irms remains the same, but DCR increases.

Example: For HP1-1400L, connect three secondary windings in series:

DCR $=$ DCR$_{table} \times$ W$_{sec}$
$\qquad = 0.130 \times 3 = 0.39$ Ohms

Irms $=$ Irms$_{table}$
$\qquad = 0.74$

4 10
1 7
5 11
Pri **Sec**
2 8
6 12
3 9

Primary:
L = 806.4 µH
DCR = 0.39Ω
Irms = 0.74 A
VT = 70.2 V-µsec

Secondary:
DCR = 0.39Ω
Irms = 0.74 A

Coilcraft®

Document 613-10   Revised 08/14/08